
Section 22 Connecticut

Appendix N

Connecticut Coastal Structures Inventory Study - Phase III

January 1990



**US Army Corps
of Engineers**
New England Division

REPORT DOCUMENTATION PAGE			Form Approved OMB No. 0704-0188	
<small>PUBLIC RELEASE: DURING FOR THE COLLECTION OF INFORMATION IS ESTIMATED TO AVERAGE 1 HOUR PER RESPONSE, INCLUDING THE TIME FOR REVIEWING INSTRUCTIONS, SEARCHING EXISTING DATA SOURCES, GATHERING AND REPRODUCING THE DATA NEEDED, AND COMPLETING AND REVIEWING THE COLLECTION OF INFORMATION. Some comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA 22202-4302, and to the Office of Management and Budget, Paperwork Reduction Project (0704-0188), Washington, DC 20503.</small>				
1. AGENCY USE ONLY (Leave blank)	2. REPORT DATE January 1990	3. REPORT TYPE AND DATES COVERED Section 22		
4. TITLE AND SUBTITLE Section 22, Connecticut Coastal Structures Inventory Study, Phase III, Appendix N, Bridgeport Quadrangle, Records of Structures With Photographs		5. FUNDING NUMBERS		
6. AUTHOR(S) U.S. Army Corps of Engineers New England Division				
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES) U.S. Army Corps of Engineers, New England Division 424 Trapelo Road Waltham, MA 02254-9149		8. PERFORMING ORGANIZATION REPORT NUMBER		
9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES) Connecticut Department of Environmental Protection Coastal Resources Management Division		10. SPONSORING/MONITORING AGENCY REPORT NUMBER		
11. SUPPLEMENTARY NOTES				
12a. DISTRIBUTION/AVAILABILITY STATEMENT Approved for public release Distribution is unlimited		12b. DISTRIBUTION CODE		
13. ABSTRACT (Maximum 200 words) This Appendix N report contains data gathered during Phase III of the ongoing project to inventory erosion and flood control structures on the northern shore of Long Island Sound within the statutory boundaries of the State of Connecticut. Included are the record of information on each structure and photographs for each structure.				
14. SUBJECT TERMS Bridgeport Quadrangle; coastal regions; structures		15. NUMBER OF PAGES 88		
		16. PRICE CODE		
17. SECURITY CLASSIFICATION OF REPORT Unclassified	18. SECURITY CLASSIFICATION OF THIS PAGE Unclassified	19. SECURITY CLASSIFICATION OF ABSTRACT Unclassified	20. LIMITATION OF ABSTRACT	

GENERAL INSTRUCTIONS FOR COMPLETING SF 298

The Report Documentation Page (RDP) is used in announcing and cataloging reports. It is important that this information be consistent with the rest of the report, particularly the cover and title page. Instructions for filling in each block of the form follow. It is important to *stay within the lines* to meet optical scanning requirements.

Block 1. Agency Use Only (Leave blank).

Block 2. Report Date. Full publication date including day, month, and year, if available (e.g. 1 Jan 88). Must cite at least the year.

Block 3. Type of Report and Dates Covered. State whether report is interim, final, etc. If applicable, enter inclusive report dates (e.g. 10 Jun 87 - 30 Jun 88).

Block 4. Title and Subtitle. A title is taken from the part of the report that provides the most meaningful and complete information. When a report is prepared in more than one volume, repeat the primary title, add volume number, and include subtitle for the specific volume. On classified documents enter the title classification in parentheses.

Block 5. Funding Numbers. To include contract and grant numbers; may include program element number(s), project number(s), task number(s), and work unit number(s). Use the following labels:

C - Contract	PR - Project
G - Grant	TA - Task
PE - Program Element	WU - Work Unit Accession No.

Block 6. Author(s). Name(s) of person(s) responsible for writing the report, performing the research, or credited with the content of the report. If editor or compiler, this should follow the name(s).

Block 7. Performing Organization Name(s) and Address(es). Self-explanatory.

Block 8. Performing Organization Report Number. Enter the unique alphanumeric report number(s) assigned by the organization performing the report.

Block 9. Sponsoring/Monitoring Agency Name(s) and Address(es). Self-explanatory.

Block 10. Sponsoring/Monitoring Agency Report Number. (If known)

Block 11. Supplementary Notes. Enter information not included elsewhere such as: Prepared in cooperation with....; Trans. of....; To be published in.... When a report is revised, include a statement whether the new report supersedes or supplements the older report.

Block 12a. Distribution/Availability Statement. Denotes public availability or limitations. Cite any availability to the public. Enter additional limitations or special markings in all capitals (e.g. NOFORN, REL, ITAR).

DOD - See DoDD 5230.24, "Distribution Statements on Technical Documents."

DOE - See authorities.

NASA - See Handbook NHB 2200.2.

NTIS - Leave blank.

Block 12b. Distribution Code.

DOD - Leave blank.

DOE - Enter DOE distribution categories from the Standard Distribution for Unclassified Scientific and Technical Reports.

NASA - Leave blank.

NTIS - Leave blank.

Block 13. Abstract. Include a brief (Maximum 200 words) factual summary of the most significant information contained in the report.

Block 14. Subject Terms. Keywords or phrases identifying major subjects in the report.

Block 15. Number of Pages. Enter the total number of pages.

Block 16. Price Code. Enter appropriate price code (NTIS only).

Blocks 17. - 19. Security Classifications. Self-explanatory. Enter U.S. Security Classification in accordance with U.S. Security Regulations (i.e., UNCLASSIFIED). If form contains classified information, stamp classification on the top and bottom of the page.

Block 20. Limitation of Abstract. This block must be completed to assign a limitation to the abstract. Enter either UL (unlimited) or SAR (same as report). An entry in this block is necessary if the abstract is to be limited. If blank, the abstract is assumed to be unlimited.

SECTION 22
CONNECTICUT COASTAL STRUCTURES INVENTORY STUDY
PHASE III

APPENDIX N
BRIDGEPORT QUADRANGLE

RECORDS OF STRUCTURES WITH PHOTOGRAPHS

DEPARTMENT OF THE ARMY
NEW ENGLAND DIVISION, CORPS OF ENGINEERS
WALTHAM, MASSACHUSETTS

INVENTORY NUMBER: 1.00

QUAD : BRIDGEPORT
ADDRESS: BEACH DRIVE
TOWN : STRATFORD
COUNTY : FAIRFIELD

STATE : CT

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL-RIPRAP CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER-RIPRAP PREVENTS EROSION O
MATERIAL : STONE IN CEMENT

DESCRIPTION

L(FT)=900
W(FT)=2
H(FT ABOVE MHW)=5

INSPECTION DATE : 06/06/89 INSPECTION TIME: 1500

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : TOWN OF STRATFORD
ACCESS : PUBLIC
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL100 NEG #10 LOOKING NORTH
#2
#3
#4
#5

COMMENTS

PEBBLY, SANDY BEACH

INVENTORY NUMBER: 2.00

QUAD : BRIDGEPORT
ADDRESS: BEACH DRIVE
TOWN : STRATFORD
COUNTY : FAIRFIELD

STATE : CT

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: POOR
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : STONE-LGBOULDER

DESCRIPTION

L(FT)=50
W(FT)=15 TO 10
H(FT ABOVE MHW)= 0 TO 3

INSPECTION DATE : 06/06/89 INSPECTION TIME: 1512

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : TOWN OF STATFORD
ACCESS : PUBLIC
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 100 NEG #11 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

GROIN HAS FALLEN APART MAKING IT DIFFICULT TO MEASURE

INVENTORY NUMBER: 3.00

QUAD : BRIDGEPORT
ADDRESS: BEACH DRIVE
TOWN : STRATFORD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: POOR
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : STONE-LGBOULDER

DESCRIPTION

L(FT)=75
W(FT)=15
H(FT ABOVE MHW)= 0 TO 5

INSPECTION DATE : 06/06/89 INSPECTION TIME: 1515

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PUBLIC
ACCESS : PUBLIC
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 100 NEG #12 - LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

GROIN HAS FALLEN APART MAKING IT DIFFICULT TO MEASURE

INVENTORY NUMBER: 4.00

QUAD : BRIDGEPORT
ADDRESS: BEACH DRIVE
TOWN : STRATFORD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: POOR
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : STONE-LGBoulder

DESCRIPTION

L(FT)=100
W(FT)=60 FT AT THE BASE - TAPERS DOWN TO THE POINT
H(FT ABOVE MHW) = 0 TO 5

INSPECTION DATE : 06/06/89 INSPECTION TIME: 1517

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : TOWN OF STRATFORD
ACCESS : PUBLIC
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 100 NEG #13 LOOKING EAST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 5.00

QUAD : BRIDGEPORT
ADDRESS: 33 BEACH DRIVE
TOWN : STRATFORD
COUNTY : FAIRFIELD

STATE : CT

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : TIMBER PILE

DESCRIPTION

L(FT)=100
W(FT)=1
H(FT ABOVE MHW)= 0 TO 5

INSPECTION DATE : 06/06/89 INSPECTION TIME: 1520

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PUBLIC ALONG SHOREFRONT
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 100 NEG #14 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

HOUSES RAISED ON TIMBER PILES

INVENTORY NUMBER: 6.00

QUAD : BRIDGEPORT
ADDRESS: 53 BEACH DRIVE
TOWN : STRATFORD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: FAIR
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : TIMBER PILE

DESCRIPTION

L(FT)=115
W(FT)=0.5 FT
H(FT ABOVE MHW)= 0 TO 2.5

INSPECTION DATE : 06/06/89 INSPECTION TIME: 1530

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PUBLIC ACCESS FROM BEACH
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 100 NEG #15 GROIN LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

HOUSES RAISED ON TIMBER PILES

INVENTORY NUMBER: 7.00

QUAD : BRIDGEPORT
ADDRESS: 75 BEACH DRIVE
TOWN : STRATFORD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : TIMBER PILE

DESCRIPTION

L(FT)=105
W(FT)=1
H(FT ABOVE MHW)=0 TO 3.5

INSPECTION DATE : 06/06/89 INSPECTION TIME: 1545

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PUBLIC FROM ROAD
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 100 NEG #16 GROIN LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

SANDY, PEBBLY - HOUSES RAISED ON TIMBER PILES

INVENTORY NUMBER: 8.00

QUAD : BRIDGEPORT
ADDRESS: 89 BEACH DRIVE
TOWN : STRATFORD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : TIMBER PILE

DESCRIPTION

L(FT)=90
W(FT)=1
H(FT ABOVE MHW)=0-3

INSPECTION DATE : 06/06/89 INSPECTION TIME: 1550

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PUBLIC FROM BEACH
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 100 NEG #17 GROIN LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 9.00

QUAD : BRIDGEPORT
ADDRESS: 89 BEACH DRIVE
TOWN : STRATFORD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: RIPRAP CONDITION: GOOD
MAIN FUNCTION : TO PROTECT THE STORM SEWER DRAIN
MATERIAL : LARGE BOULDERS

DESCRIPTION

L(FT)=25
W(FT)=10
H(FT ABOVE MHW)=0 SEWER PIPE IS REINFORCED CONCRETE

INSPECTION DATE : 06/06/89 INSPECTION TIME: 1552

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : TOWN OF STRATFORD
ACCESS : PUBLIC FROM NEARBY ROAD
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 100 NEG #18 STONE BOULDERS LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

MAIN FUNCTION TO PROTECT THE STORM SEWER DRAIN

INVENTORY NUMBER: 10.00

QUAD : BRIDGEPORT
ADDRESS: 106 BEACH DRIVE
TOWN : STRATFORD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: POOR
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : LARGE BOULDERS

DESCRIPTION

L(FT)=125
W(FT)=FALLING APART, LOOKS LIKE IT WAS 10 FT
H(FT ABOVE MHW)= 0 TO 2

INSPECTION DATE : 06/06/89 INSPECTION TIME: 1655

- LAND CLASSIFICATION -

PERMIT NUMBER: 7270
OWNER'S NAME : PRIVATE
ACCESS : PUBLIC FROM THE ROAD
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 100 NEG #19 - GROIN LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

BUILT TO RECLAIM BEACH - 12 YEARS OLD
PERMIT WAS FOR A LENGTH OF 150 FT

INVENTORY NUMBER: 11.00

QUAD : BRIDGEPORT
ADDRESS: 126 BEACH DRIVE
TOWN : STRATFORD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: POOR
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : LARGE BOULDERS

DESCRIPTION

L(FT)= 92
W(FT)= 10 TO 15
H(FT ABOVE MHW)= 0 TO 2

INSPECTION DATE : 06/06/89 INSPECTION TIME: 1700

- LAND CLASSIFICATION -

PERMIT NUMBER: 7270
OWNER'S NAME : PRIVATE
ACCESS : PUBLIC FROM THE ROAD
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 100 NEG #20 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

PERMIT WAS FOR A LENGTH OF 150 FT

INVENTORY NUMBER: 12.00

QUAD : BRIDGEPORT
ADDRESS: 152 BEACH DRIVE
TOWN : STRATFORD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT)= 225
W(FT)= 20
H(FT ABOVE MHW) = 3 TO 0.5

INSPECTION DATE : 06/06/89 INSPECTION TIME: 1710

- LAND CLASSIFICATION -

PERMIT NUMBER: 7270
OWNER'S NAME : PRIVATE
ACCESS : PUBLIC FROM THE ROAD
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 100 NEG # 21 - LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

SANDY, PEBBLY BEACH
PERMIT WAS FOR A LENGTH OF 400 FT

INVENTORY NUMBER: 13.00

QUAD : BRIDGEPORT
ADDRESS: OAK BLUFF ROAD
TOWN : STRATFORD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT) = 250
W(FT) = 20
H(FT ABOVE MHW) = 0 TO 4

INSPECTION DATE : 06/06/89 INSPECTION TIME: 1715

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : TOWN OF STRATFORD
ACCESS : PUBLIC FROM BEACH
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 100 NEG #22 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

SANDY, PEBBLY BEACH

INVENTORY NUMBER: 14.00

QUAD : BRIDGEPORT
ADDRESS: OAK BLUFF ROAD
TOWN : STRATFORD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT)=300
W(FT)=20
H(FT ABOVE MHW)= 0 TO 5

INSPECTION DATE : 06/06/89 INSPECTION TIME: 1720

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : TOWN OF STRATFORD
ACCESS : PUBLIC ACCESS FROM BEACH
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 100 NEG#23 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

SANDY BEACH

INVENTORY NUMBER: 15.00

QUAD : BRIDGEPORT
ADDRESS: OAK BLUFF ROAD
TOWN : STRATFORD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT)=300
W(FT)=20
H(FT ABOVE MHW)=0 TO 5

INSPECTION DATE : 06/06/89 INSPECTION TIME: 1740

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : TOWN OF STRATFORD
ACCESS : PUBLIC FROM OAK BLUFF RD
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 100 NEG #24 GROIN LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

SANDY BEACH

INVENTORY NUMBER: 16.00

QUAD : BRIDGEPORT
ADDRESS: LONG BEACH
TOWN : STRATFORD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT)=330
W(FT)=20
H(FT ABOVE MHW)=0 TO 1

INSPECTION DATE : 06/07/89 INSPECTION TIME: 1020

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : TOWN OF STRATFORD
ACCESS : PUBLIC FROM OAK BLUFF RD
LAND USE : BIRD NESTING AREA

- PHOTOS -

#1 ROLL 101 NEG #1 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

SANDY BEACH

INVENTORY NUMBER: 17.00

QUAD : BRIDGEPORT
ADDRESS: LONG BEACH
TOWN : STRATFORD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT)=300
W(FT)=20
H(FT ABOVE MHW)=0 TO 4

INSPECTION DATE : 06/07/89 INSPECTION TIME: 1030

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PUBLIC
ACCESS : PUBLIC FROM OAK BLUFF RD
LAND USE : BIRD NESTING AREA

- PHOTOS -

#1 ROLL 101 NEG #2 LOOKING SOUTHWEST
#2
#3
#4
#5

COMMENTS

SANDY BEACH

INVENTORY NUMBER: 18.00

QUAD : BRIDGEPORT
ADDRESS: LONG BEACH
TOWN : STRATFORD
COUNTY : FAIRFIELD

STATE : CT

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT)=300
W(FT)=20
H(FT ABOVE MHW)=0 TO 3

INSPECTION DATE : 06/07/89 INSPECTION TIME: 1040

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : TOWN OF STRATFORD
ACCESS : PUBLIC FROM OAK BLUFF RD
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 101 NEG #3 - LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

SANDY BEACH

INVENTORY NUMBER: 19.00

QUAD : BRIDGEPORT
ADDRESS: LONG BEACH
TOWN : STRATFORD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT)=300
W(FT)=20
H(FT ABOVE MHW)= 0 TO 6

INSPECTION DATE : 06/07/89 INSPECTION TIME: 1045

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : TOWN OF STRATFORD
ACCESS : PUBLIC FROM OAK BLUFF RD
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 101 NEG #4 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

SANDY BEACH

INVENTORY NUMBER: 20.00

QUAD : BRIDGEPORT
ADDRESS: PLEASURE BEACH
TOWN : BRIDGEPORT STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: JETTY CONDITION: GOOD
MAIN FUNCTION : PREVENTS SHOALING OF CHANNEL BY LITTORAL DRIFT
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT)=3823
W(FT)=20
H(FT ABOVE MHW)=6

INSPECTION DATE : 06/07/89 INSPECTION TIME: 1100

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : CITY OF BRIDGEPORT
ACCESS : PUBLIC FROM PLEASURE BCH
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 101 NEG #5 LOOKING SOUTHWEST
#2
#3
#4
#5

COMMENTS

SANDY BEACH

INVENTORY NUMBER: 21.00

QUAD : BRIDGEPORT
ADDRESS: BARNUM BLVD
TOWN : BRIDGEPORT STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: JETTY CONDITION: GOOD
MAIN FUNCTION : PREVENTS SHOALING OF CHANNEL BY LITTORAL DRIFT
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT)=2110
W(FT)=25
H(FT ABOVE MHW)=0 TO 2

INSPECTION DATE : 06/07/89 INSPECTION TIME: 1140

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : CITY OF BRIDGEPORT
ACCESS : PUBLIC FROM SEASIDE PARK
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 101 NEG #6 LOOKING SOUTHEAST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 22.00

QUAD : BRIDGEPORT
ADDRESS: BARNUM BLVD
TOWN : BRIDGEPORT
COUNTY : FAIRFIELD

STATE : CT

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL-RIPRAP CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER WITH RIPRAP PREVENTING ER
MATERIAL : STONE IN CEMENT

DESCRIPTION

L(FT)=8500
W(FT)=2
H(FT ABOVE MHW)=8 TO 10

INSPECTION DATE : 06/07/89 INSPECTION TIME: 1145

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : CITY OF BRIDGEPORT
ACCESS : PUBLIC FROM SEASIDE BEACH
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 101 NEG #7 LOOKING WEST
#2 ROLL 101 NEG #8 LOOKING NORTHWEST
#3
#4
#5

COMMENTS

SEAWALL VARIES ALONG SEASIDE PARK.
IN SOME PLACES, RIPRAP IS NOT PRESENT.

INVENTORY NUMBER: 23.00

QUAD : BRIDGEPORT
ADDRESS: FAYERWEATHER ISLAND
TOWN : BRIDGEPORT STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: BREAKWATER CONDITION: GOOD
MAIN FUNCTION : PROTECTS HARBOR BY INTERCEPTING WAVES
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT)=1500
W(FT)=30
H(FT ABOVE MHW)=8 TO 12

INSPECTION DATE : 06/07/89 INSPECTION TIME: 1200

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : CITY OF BRIDGEPORT
ACCESS : PUBLIC FROM SEASIDE PARK
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 101 NEG #9 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

PROTECTS EXTENSION OF LAND OUT TO FAYERWEATHER ISLAND

INVENTORY NUMBER: 24.00

QUAD : BRIDGEPORT
ADDRESS: BLACK ROCK HARBOR
TOWN : BRIDGEPORT
COUNTY : FAIRFIELD
STATE : CT

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: RIPRAP
MAIN FUNCTION : PROTECTIVE LAYER WHICH PREVENTS EROSION OF A SLOPE
MATERIAL : LARGE BOULDERS
CONDITION: GOOD

DESCRIPTION

L(FT)=2000
W(FT)=N/A
H(FT ABOVE MHW)=10

INSPECTION DATE : 06/07/89 INSPECTION TIME: 1210

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : CITY OF BRIDGEPORT
ACCESS : PUBLIC
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 101 NEG #10 LOOKING NORTH
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 25.00

QUAD : BRIDGEPORT
ADDRESS: BLACK ROCK YACHT CLUB
TOWN : BRIDGEPORT STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOOD
MATERIAL : STONE

DESCRIPTION

L(FT)=300
W(FT)=4
H(FT ABOVE MHW)=6

INSPECTION DATE : 06/07/89 INSPECTION TIME: 1430

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RECREATIONAL - COMMERCIAL

- PHOTOS -

#1 ROLL 101 NEG #11
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 26.00

QUAD : BRIDGEPORT
ADDRESS: GROVERS AVENUE
TOWN : BRIDGEPORT STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION
MATERIAL : STONE&CONCRETE

DESCRIPTION

L(FT)=2600
W(FT)=N/A
H(FT ABOVE MHW)=10 TO 15

INSPECTION DATE : 06/07/89 INSPECTION TIME: 1440

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : CITY OF BRIDGEPORT
ACCESS : PUBLIC OFF OF ROAD
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 101 NEG #12 SEAWALL LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

SEAWALL PROTECTS ROAD AROUND GROVERS HILL POINT

INVENTORY NUMBER: 27.00

QUAD : BRIDGEPORT
ADDRESS: GILMAN ROAD(ASH CREEK)
TOWN : BRIDGEPORT STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: POOR
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : IRR. STONE FRAG

DESCRIPTION

L(FT) = 100
W(FT) = 15 - 20 FT
H(FT ABOVE MHW) = 4 FT

INSPECTION DATE : 06/20/89 INSPECTION TIME: 1330

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : CITY OF BRIDGEPORT
ACCESS : PUBLIC FROM ROAD
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 101 NEG 13 LOOKING WEST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 28.00

QUAD : BRIDGEPORT
ADDRESS: JENNINGS BEACH-ASH CREEK
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: JETTY CONDITION: GOOD
MAIN FUNCTION : PREVENTS SHOALING OF CHANNEL BY LITTORAL DRIFT
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT)=800
W(FT)=22
H(FT ABOVE MHW)=6-7

INSPECTION DATE : 06/20/89 INSPECTION TIME: 1350

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PUBLIC - BUILT BY CORPS
ACCESS : PUBLIC - JENNINGS BEACH
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 101 NEG #14 LOOKING SOUTHWEST
#2
#3
#4
#5

COMMENTS

CEMENT PEDESTRIAN WALKWAY ON TOP OF BEACH

INVENTORY NUMBER: 29.00

QUAD : BRIDGEPORT
ADDRESS: JENNINGS BEACH
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOOD
MATERIAL : CONCRETE

DESCRIPTION

L(FT)= 56
W(FT)=11.5
H(FT ABOVE MHW)= 5 (TOTALLY ABOVE)

INSPECTION DATE : 06/20/89 INSPECTION TIME: 1415

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : TOWN OF FAIRFIELD
ACCESS : PUBLIC (FEE FOR ENTRANCE)
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 101 NEG #15 LOOKING NORTHWEST
#2 ROLL 101 NEG #16 NORTH FROM ABOVE
#3
#4
#5

COMMENTS

FILLS THE BREAK IN THE SAND DUNES BY THE BEACH HOUSE
WIDTH - 4 FT CONCRETE SECTION - 3.5 FT DIRT SECTION
4 FT CONCRETE SECTION

INVENTORY NUMBER: 30.00

QUAD : BRIDGEPORT
ADDRESS: FAIRFIELD BEACH
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: FAIR
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOODING
MATERIAL : STONE

DESCRIPTION

L(FT)=200
W(FT)=3
H(FT ABOVE MHW)=5

INSPECTION DATE : 06/20/89 INSPECTION TIME: 1515

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : TOWN OF FAIRFIELD
ACCESS : PUBLIC
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 101 NEG#17 LOOKING NORTH
#2 ROLL 101 NEG#18 LOOKING NORTH
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 31.00

QUAD : BRIDGEPORT
ADDRESS: FAIRFIELD BEACH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL-BULKHD CONDITION: FAIR
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOODING
MATERIAL : CONCRETE

DESCRIPTION

L(FT) = 130
W(FT) = 1.5
H(FT ABOVE MHW) = 3

INSPECTION DATE : 06/20/89 INSPECTION TIME: 1515

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : TOWN OF FAIRFIELD
ACCESS : PUBLIC
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 101 NEG #19 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

PARTS OF SEAWALL ARE COMPLETELY BURIED BY THE SAND

INVENTORY NUMBER: 32.00

QUAD : BRIDGEPORT
ADDRESS: 433-487 FAIRFIELD BCH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOOD
MATERIAL : CONCRETE

DESCRIPTION

L(FT)=125
W(FT)=1.5
H(FT ABOVE MHW)=5 - 6

INSPECTION DATE : 06/20/89 INSPECTION TIME: 1525

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PUBLIC FROM FAIRFIELD BCH
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 101 NEG #20 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 33.00

QUAD : BRIDGEPORT
ADDRESS: 489-493 FAIRFIELD BCH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOOD
MATERIAL : CONCRETE

DESCRIPTION

L(FT)=40
W(FT)=2
H(FT ABOVE MHW)=8

INSPECTION DATE : 06/20/89 INSPECTION TIME: 1530

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE-PUBLIC
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 101 NEG#21 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

BUILT WITH STAIRS - ACCESS TO THE BEACH

INVENTORY NUMBER: 34.00

QUAD : BRIDGEPORT
ADDRESS: 505-535 FAIRFIELD BCH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOODING
MATERIAL : CONCRETE

DESCRIPTION

L(FT)=280
W(FT)=1.2
H(FT ABOVE MHW)=5

INSPECTION DATE : 06/20/89 INSPECTION TIME: 1530

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PUBLIC FROM FAIRFIELD BCH
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 101 NEG#22 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 35.00

QUAD : BRIDGEPORT
ADDRESS: 555-575 FAIRFIELD BCH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOOD
MATERIAL : CONCRETE

DESCRIPTION

L(FT) = 175
W(FT) = 15
H(FT ABOVE MHW) = 5, PARTS OF THE SEAWALL ARE OVER 8

INSPECTION DATE : 06/20/89 INSPECTION TIME: 160

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PUBLIC FROM BEACH
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 101 NEG#23 LOOKING SOUTH
#2 ROLL 101 NEG#24 LOOKING SOUTH, 575 BEACH ROAD
#3 ROLL 102 NEG#1 LOOKING SOUTH, 575 BEACH ROAD
#4
#5

COMMENTS

SEAWALL IS COVERED WITH SAND FROM HOUSE # 575 - END.

INVENTORY NUMBER: 36.00

QUAD : BRIDGEPORT
ADDRESS: 575 FAIRFIELD BEACH ROAD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT)=300
W(FT)=20
H(FT ABOVE MHW) = 0 TO 3 - 4

INSPECTION DATE : 06/20/89 INSPECTION TIME: 1700

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PUBLIC
ACCESS : PRIVATE-PUBLIC FROM BEACH
LAND USE : RECREATIONAL

- PHOTOS -

#1 ROLL 102 NEG#2 LOOKING EAST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 37.00

QUAD : BRIDGEPORT
ADDRESS: 661 FAIRFIELD BEACH ROAD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOOD
MATERIAL : CONCRETE

DESCRIPTION

L(FT)=40
W(FT)=.8
H(FT ABOVE MHW)=5

INSPECTION DATE : 06/20/89 INSPECTION TIME: 1720

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#5
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 38.00

QUAD : BRIDGEPORT
ADDRESS: 669-713 FAIRFIELD BCH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: FAIR
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOODING
MATERIAL : CONCRETE

DESCRIPTION

L(FT)=350
W(FT)=1
H(FT ABOVE MHW)=4

INSPECTION DATE : 06/20/89 INSPECTION TIME: 1730

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#6 LOOKING WEST
#2 ROLL 102 NEG#7 LOOKING SOUTH
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 39.00

QUAD : BRIDGEPORT
ADDRESS: 689 FAIRFIELD BEACH ROAD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT)=300
W(FT)=20
H(FT ABOVE MHW)=0 TO 3-4

INSPECTION DATE : 06/20/89 INSPECTION TIME: 1715

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : TOWN OF FAIRFIELD
ACCESS : PRIVATE
LAND USE : RESIDENTIAL-RECREATIONAL

- PHOTOS -

#1 ROLL 102 NEG#4 LOOKING EAST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 40.00

QUAD : BRIDGEPORT
ADDRESS: 741-793 FAIRFIELD BCH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: FAIR
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOODING
MATERIAL : CONCRETE

DESCRIPTION

L(FT)=400
W(FT)=.8
H(FT ABOVE MHW)=5-6

INSPECTION DATE : 06/20/89 INSPECTION TIME: 1735

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#8 LOOKING SOUTH
#2 ROLL 102 NEG#9 LOOKING WEST
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 41.00

QUAD : BRIDGEPORT
ADDRESS: 803 FAIRFIELD BEACH ROAD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: POOR
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : WOOD PILES-ROCK

DESCRIPTION

L(FT)=200
W(FT)=WOOD SECTION -.5 FT ROCKS- 15 -20 FT
H(FT ABOVE MHW)= 0 TO 4 FT

INSPECTION DATE : 06/20/89 INSPECTION TIME: 0

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#10 LOOKING EAST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 42.00

QUAD : BRIDGEPORT
ADDRESS: 2 LIGHTHOUSE POINT
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT)=375
W(FT)=30
H(FT ABOVE MHW)=3-4

INSPECTION DATE : 06/20/89 INSPECTION TIME: 1750

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : TOWN OF FAIRFIELD
ACCESS : PUBLIC
LAND USE : RESIDENTIAL-RECREATIONAL-FISH

- PHOTOS -

#1 ROLL 102 NEG#11 LOOKING EAST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 43.00

QUAD : BRIDGEPORT
ADDRESS: 4 LIGHTHOUSE POINT
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: FAIR
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOOD
MATERIAL : CONCRETE

DESCRIPTION

L(FT)=90
W(FT)=1
H(FT ABOVE MHW)=4-5

INSPECTION DATE : 06/24/89 INSPECTION TIME: 900

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#12 LOOKING EAST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 44.00

QUAD : BRIDGEPORT
ADDRESS: 4 LIGHTHOUSE POINT
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOODING
MATERIAL : WOOD

DESCRIPTION

L(FT)= 320
W(FT)= 1.5
H(FT ABOVE MHW)=4-5

INSPECTION DATE : 06/21/89 INSPECTION TIME: 910

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#13 LOOKING WEST AT THE BEGINNING OF THE SEAWALL
#2 ROLL 102 NEG#14 LOOKING EAST AT THE END(ALMOST COVERED BY
#3 SAND AT THE END)
#4
#5

COMMENTS

PART BUILT IN FRONT OF THE EXISTING CEMENT SEAWALL (1FT WIDT
H) WITH SAND BETWEEN, PORTION OF JUST THE OLD CEMENT , THEN
JUST WOOD.

INVENTORY NUMBER: 45.00

QUAD : BRIDGEPORT
ADDRESS: FAIRFIELD BEACH ROAD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT)=315
W(FT)=30
H(FT ABOVE MHW)=0 TO 2-3

INSPECTION DATE : 06/21/89 INSPECTION TIME: 930

- LAND CLASSIFICATION -

PERMIT NUMBER: 7286
OWNER'S NAME : TOWN OF FAIRFIELD
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#17 LOOKING SOUTHEAST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 46.00

QUAD : BRIDGEPORT
ADDRESS: 901-911 FAIRFIELD BCH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOOD
MATERIAL : WOOD

DESCRIPTION

L(FT)= 140
W(FT)= 1
H(FT ABOVE MHW)= 4-5

INSPECTION DATE : 06/21/89 INSPECTION TIME: 915

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#15 LOOKING WEST
#2 ROLL 102 NEG#16 LOOKING WEST
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 47.00

QUAD : BRIDGEPORT
ADDRESS: 919-963 FAIRFIELD BCH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOOD
MATERIAL : WOOD

DESCRIPTION

L(FT)=320
W(FT)=1
H(FT ABOVE MHW)=4-5

INSPECTION DATE : 06/21/89 INSPECTION TIME: 937

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#18 LOOKING SOUTHWEST
#2 ROLL 102 NEG#19 LOOKING NORTHEAST
#3 ROLL 102 NEG#20 LOOKING NORTHEAST
#4
#5

COMMENTS

SAND IS ALMOST AT THE TOP OF THE SEAWALL AT THE BEGINNING

INVENTORY NUMBER: 48.00

QUAD : BRIDGEPORT
ADDRESS: 931 FAIRFIELD BEACH ROAD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: FAIR
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : WOOD

DESCRIPTION

L(FT)=120
W(FT)=1
H(FT ABOVE MHW)=0 TO 1-2 FT

INSPECTION DATE : 06/21/89 INSPECTION TIME: 940

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#21 LOOKING SOUTHEAST
#2
#3
#4
#5

COMMENTS

STARTS AT THE SEAWALL(INVENTORY #94) WITH THE FIRST PART
BEING BURIED BY SAND.

INVENTORY NUMBER: 49.00

QUAD : BRIDGEPORT
ADDRESS: 971 FAIRFIELD BEACH ROAD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: POOR
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : WOOD

DESCRIPTION

L(FT)=120
W(FT)=1
H(FT ABOVE MHW)=0 TO 1-2

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1005

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#21 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 50.00

QUAD : BRIDGEPORT
ADDRESS: 971-981 FAIRFIELD BCH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOODING
MATERIAL : WOOD

DESCRIPTION

L(FT)=140
W(FT)=N/A (WOODEN DECK)
H(FT ABOVE MHW)=3

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1010

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#23 LOOKING SOUTHWEST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 51.00

QUAD : BRIDGEPORT
ADDRESS: 981 FAIRFIELD BEACH ROAD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: POOR
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : WOOD

DESCRIPTION

L(FT)=50
W(FT)=1
H(FT ABOVE MHW)=0 TO 3

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1015

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#24 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 52.00

QUAD : BRIDGEPORT
ADDRESS: 989-1001 FAIRFIELD BCH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOODING
MATERIAL : WOOD

DESCRIPTION

L(FT)= 140
W(FT)= .5 WHERE APPLICABLE
H(FT ABOVE MHW)= 4-5

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1030

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#25 LOOKING SOUTHWEST
#2 ROLL 102 NEG#26 LOOKING NORTH
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 53.00

QUAD : BRIDGEPORT
ADDRESS: 1001 FAIRFIELD BEACH ROAD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: FAIR
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : WOOD

DESCRIPTION

L(FT)=100
W(FT)=1
H(FT ABOVE MHW)=0 TO 1

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1030

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#27 LOOKING WEST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 54.00

QUAD : BRIDGEPORT
ADDRESS: 1015 FAIRFIELD BEACH ROAD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: FAIR
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : WOOD

DESCRIPTION

L(FT)= 35
W(FT)= 1
H(FT ABOVE MHW)= 0 TO 2

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1210

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 100 NEG#28 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 55.00

QUAD : BRIDGEPORT
ADDRESS: FAIRFIELD BEACH ROAD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOOD
MATERIAL : WOOD

DESCRIPTION

L(FT)=35
W(FT)=2
H(FT ABOVE MHW)=6

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1220

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#29 LOOKING WEST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 56.00

QUAD : BRIDGEPORT
ADDRESS: 1037 FAIRFIELD BEACH ROAD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOOD
MATERIAL : WOOD

DESCRIPTION

L(FT)=210
W(FT)=1 WHERE APPLICABLE
H(FT ABOVE MHW)=5

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1220

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#30 LOOKING SOUTHWEST
#2 ROLL 102 NEG#31 LOOKING NORTHEAST
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 57.00

QUAD : BRIDGEPORT
ADDRESS: 1037 FAIRFIELD BEACH ROAD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: FAIR
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : WOOD

DESCRIPTION

L(FT)=100
W(FT)=1
H(FT ABOVE MHW)=0 TO 1

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1225

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#32 SOUTHEAST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 58.00

QUAD : BRIDGEPORT
ADDRESS: 1063 FAIRFIELD BEACH ROAD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : STONE BLOCKS

DESCRIPTION

L(FT)=150
W(FT)=20
H(FT ABOVE MHW)= 0 TO 2

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1235

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : TOWN OF FAIRFIELD
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#33 LOOKING SOUTHEAST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 59.00

QUAD : BRIDGEPORT
ADDRESS: 1073-1091 FAIRFIELD BCH R
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLOODING
MATERIAL : CONCRETE

DESCRIPTION

L(FT)=100
W(FT)=NOT APPLICABLE
H(FT ABOVE MHW)=4

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1240

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#34 LOOKING SOUTHWEST FOR THE CEMENT PORTION
#2 ROLL 102 NEG 35 LOOKING SOUTHWEST FOR THE WOOD PORTION
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 60.00

QUAD : BRIDGEPORT
ADDRESS: 1091 FAIRFIELD BEACH ROAD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: GOOD
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : WOOD

DESCRIPTION

L(FT)=75
W(FT)=1
H(FT ABOVE MHW)=0-2

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1250

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 102 NEG#36 LOOKING SOUTHWEST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 61.00

QUAD : BRIDGEPORT
ADDRESS: 1091&NEXT FAIRFIELD BCH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLO
MATERIAL : CONCRETE

DESCRIPTION

L(FT)= 55
W(FT)= NOT APPLICABLE (WALKWAY)
H(FT ABOVE MHW)= 4.5

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1410

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 103 NEG#1 LOOKING SOUTHWEST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 62.00

QUAD : BRIDGEPORT
ADDRESS: 1107-1127 FAIRFIELD BCH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: GOOD
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLO
MATERIAL : CONCRETE

DESCRIPTION

L(FT)= 200
W(FT)= NOT APPLICABLE
H(FT ABOVE MHW)= 5

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1415

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 103 NEG#2 LOOKING SOUTHWEST
#2 ROLL 103 NEG#3 LOOKING SOUTHWEST, BRACED SEAWALL
#3
#4
#5

COMMENTS

WOOD FACED CONCRETE

INVENTORY NUMBER: 63.00

QUAD : BRIDGEPORT
ADDRESS: 1107 FAIRFIELD BCH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: POOR
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : WOOD

DESCRIPTION

L(FT)= 50
W(FT)= 0.8
H(FT ABOVE MHW)= 0-1

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1425

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 103 NEG#4 LOOKING EAST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 64.00

QUAD : BRIDGEPORT
ADDRESS: 1127 FAIRFIELD BCH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: POOR
MAIN FUNCTION : TRAPS LOTTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : WOOD

DESCRIPTION

L(FT)= 10
W(FT)= 1
H(FT ABOVE MHW)= 0-4

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1450

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 103 NEG#5 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 65.00

QUAD : BRIDGEPORT
ADDRESS: 1135-1165 FAIRFIELD BCH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: SEAWALL CONDITION: FAIR
MAIN FUNCTION : SEPARATES LAND AND WATER, PREVENTS EROSION AND FLO
MATERIAL : CONCRETE

DESCRIPTION

L(FT) = 240
W(FT) = 1.5 WHERE APPLICABLE
H(FT ABOVE MHW) = 5-3 (DOWNWARD SLOPING)

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1455

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTIAL

- PHOTOS -

#1 ROLL 103 NEG#6 LOOKING EAST
#2
#3
#4
#5

COMMENTS

INVENTORY NUMBER: 66.00

QUAD : BRIDGEPORT
ADDRESS: 1165 FAIRFIELD BCH RD
TOWN : FAIRFIELD STATE : CT
COUNTY : FAIRFIELD

- STRUCTURAL INVESTIGATIONS -

TYPE OF STRUCTURE: GROIN CONDITION: POOR
MAIN FUNCTION : TRAPS LITTORAL DRIFT, RETARDS SHORE EROSION
MATERIAL : WOOD

DESCRIPTION

L(FT)= 50
W(FT)= 0.1-1
H(FT ABOVE MHW)= 0-1

INSPECTION DATE : 06/21/89 INSPECTION TIME: 1505

- LAND CLASSIFICATION -

PERMIT NUMBER: 0
OWNER'S NAME : PRIVATE
ACCESS : PRIVATE
LAND USE : RESIDENTAL

- PHOTOS -

#1 ROLL 103 NEG#7 LOOKING SOUTH
#2
#3
#4
#5

COMMENTS

ALL THE WOOD GOINS IN THE AREA WERE BURIED BY SAND AND WERE
RECENTLY DISCOVERED WHEN THE BEACH ERODED AWAY.

BG 1 #1



BG 2 #1



BG 3 #1




BG 4 #1




BG 5 #1



BG 6 #1

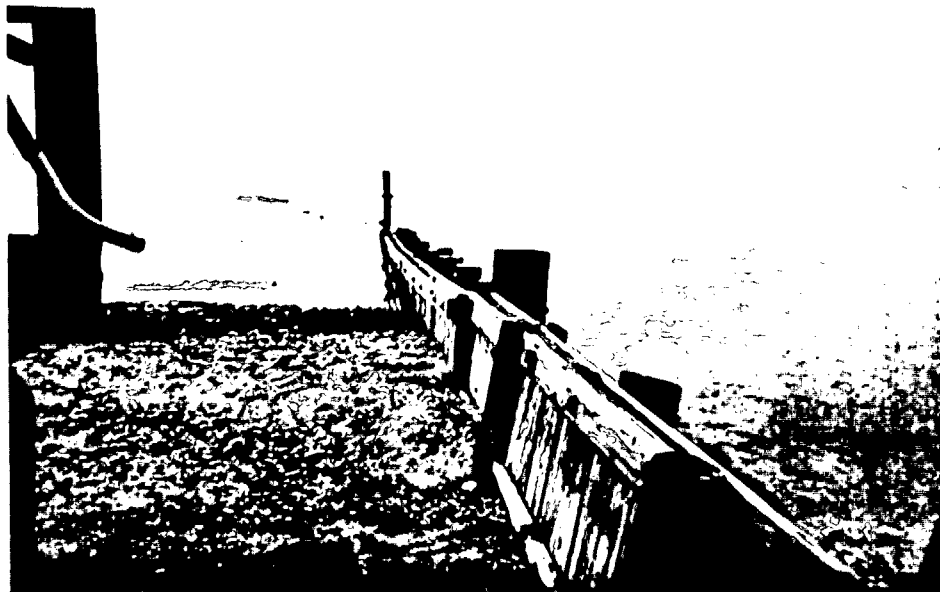


BG 7 #1

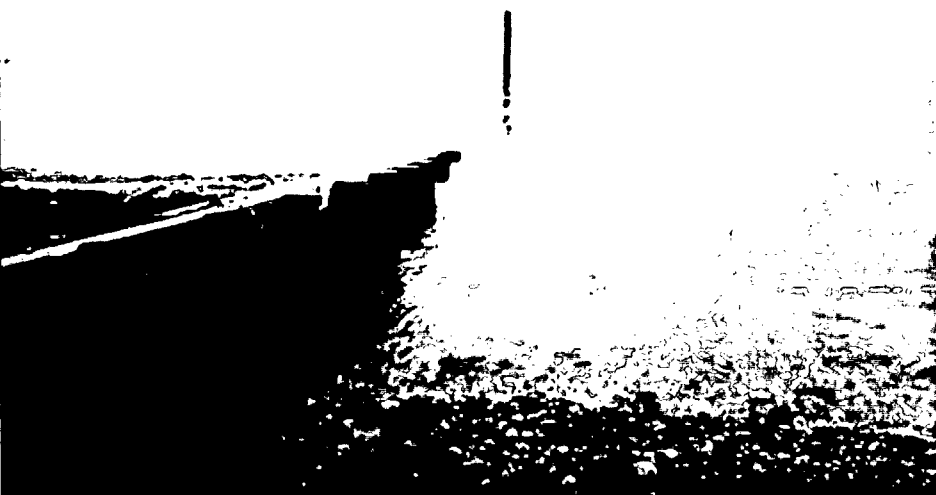


BG 8 #1



BG 9 #1

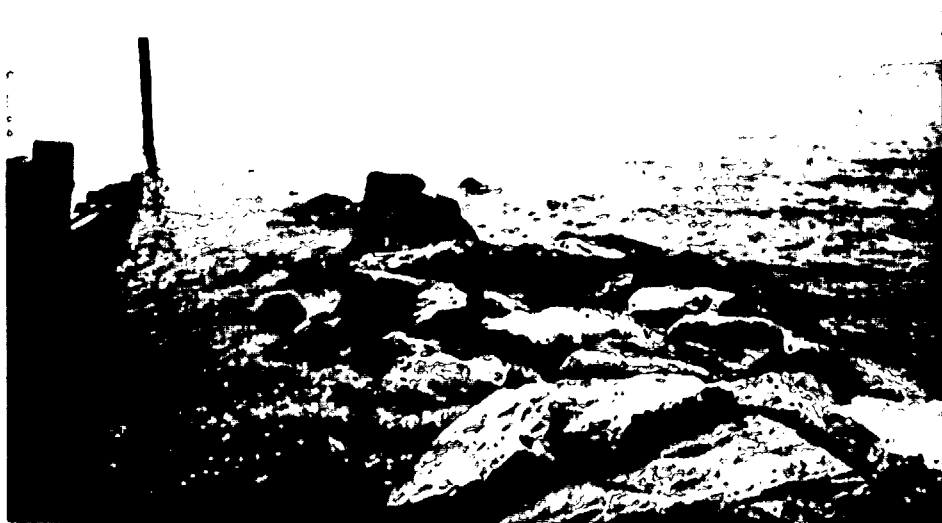

BG 10 #1

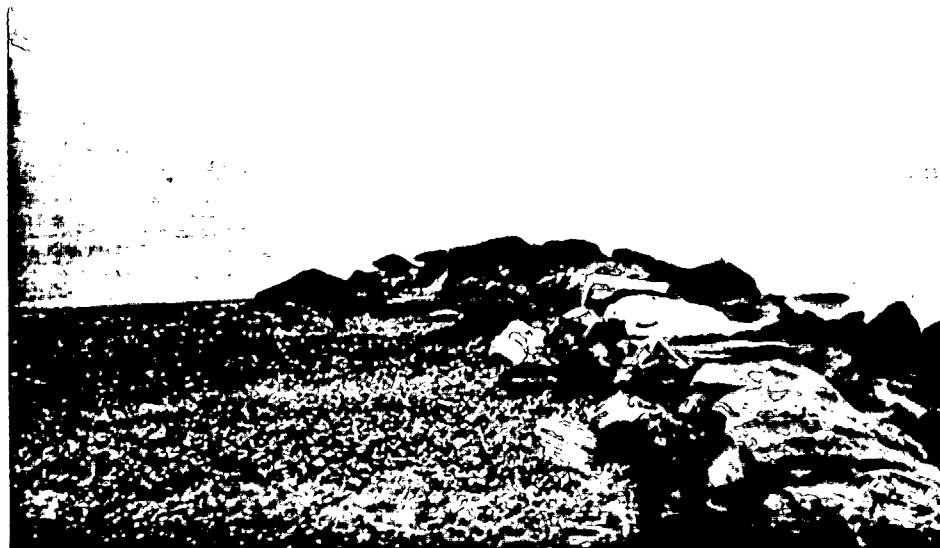

BG 11 #1



BG 12 #1



BG 13 #1




BG 14 #1



BG 15 #1



BG 16 #1

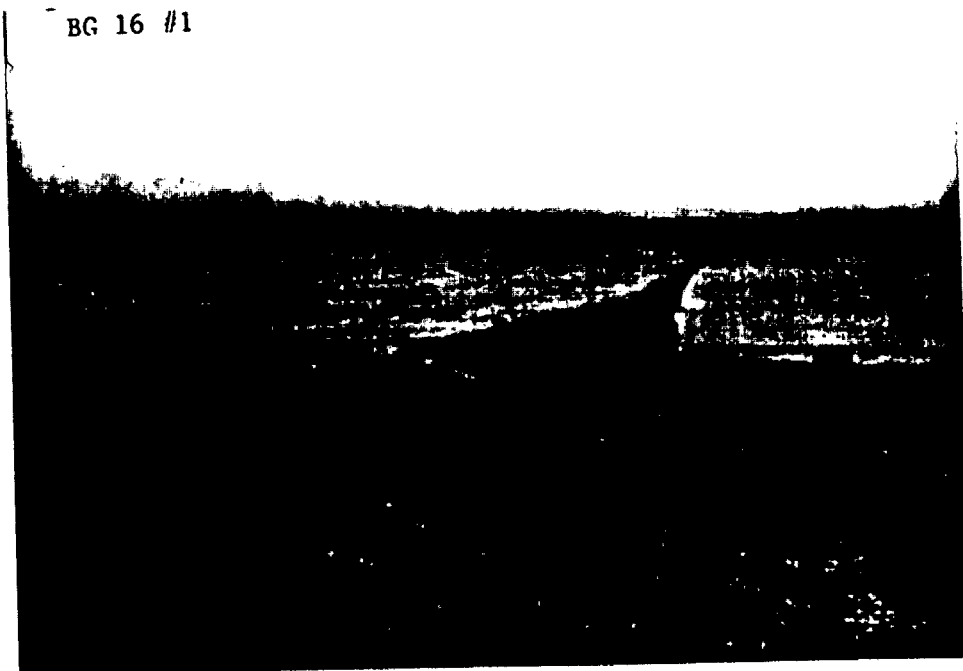

BG 17 #1

BG 18 #1

BG 19 #1

BG 20 #1

BG 21 #1




BG 22 #1



BG 22 #2



BG 23 #1

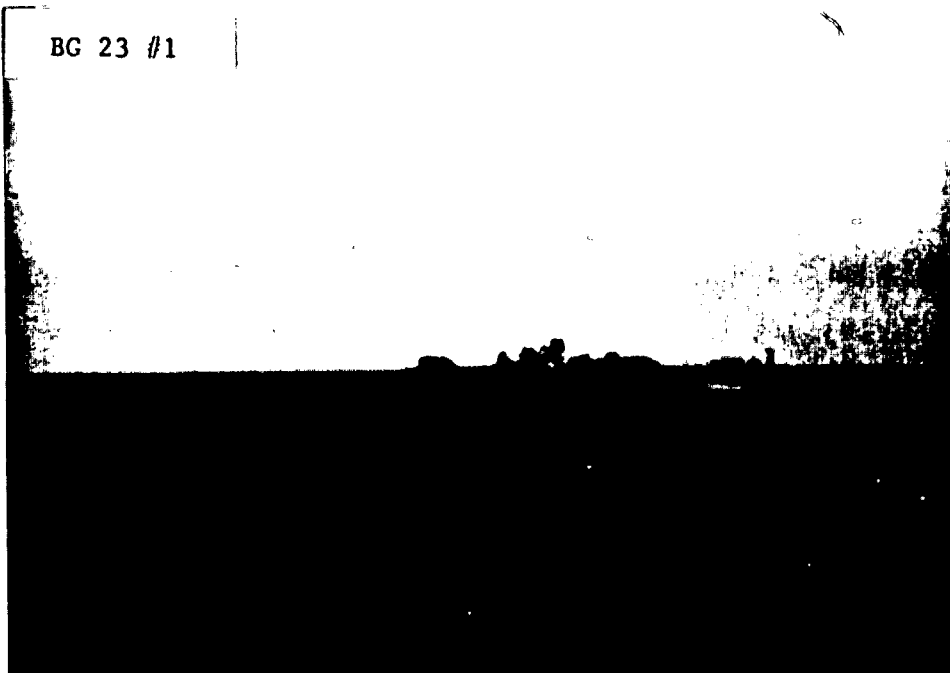

BG 24 #1



BG 25 #1



BG 26 #1



BG 27 #1




BG 28 #1




BG 29 #1



BG 29 #2

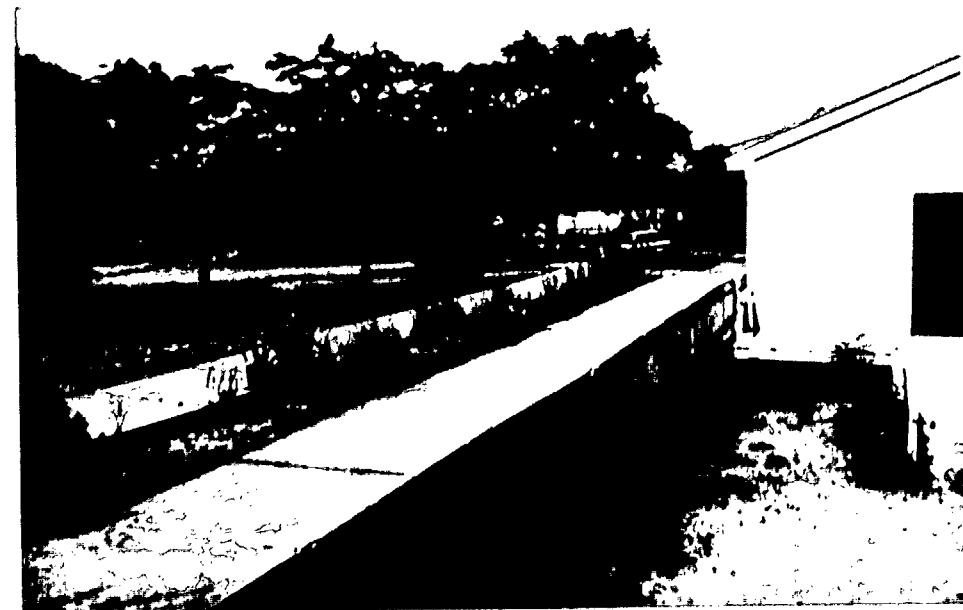


BG 30 #1

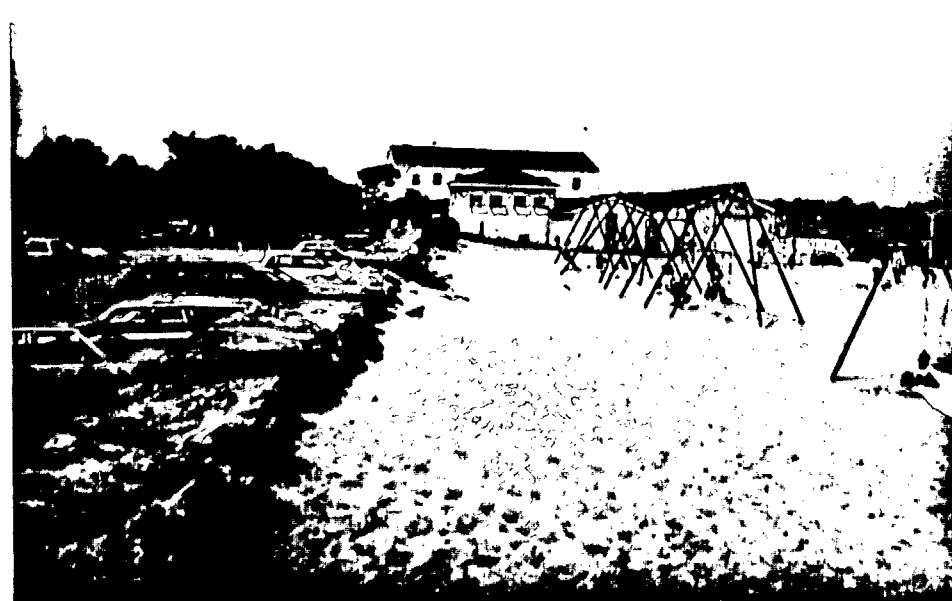

BG 30 #2



BG 31 #1

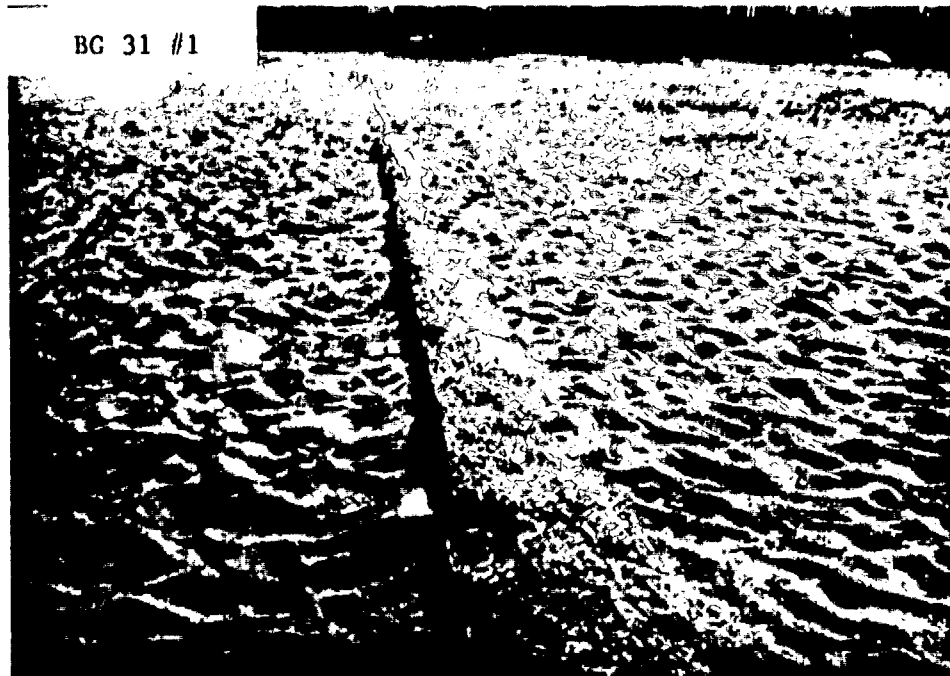

BG 32 #1



BG 33 #1




BG 34 #1




BG 35 #1



BG 35 #2

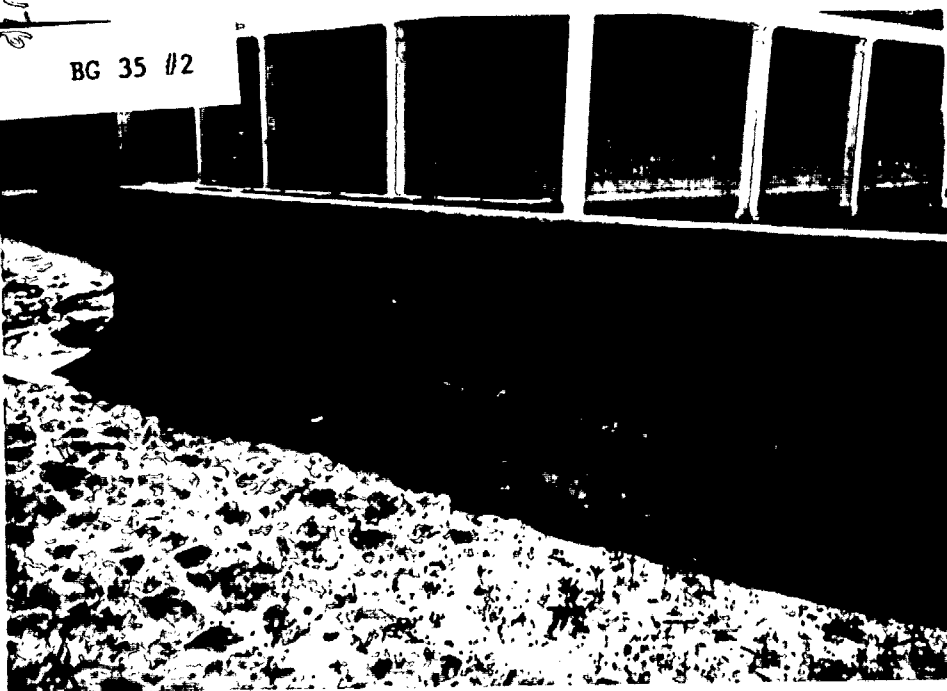

BG 35 # 3

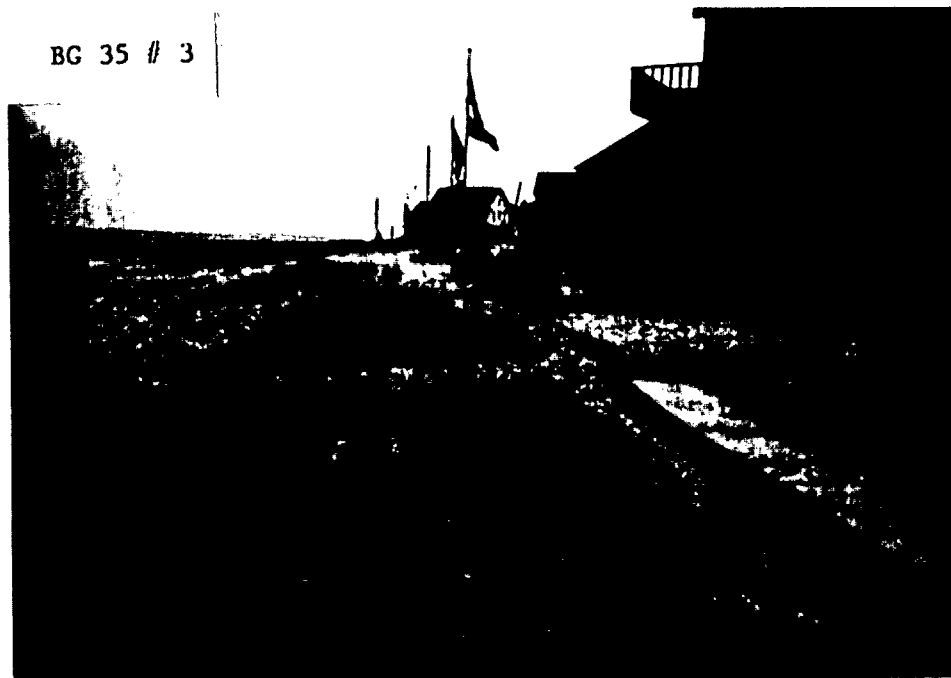


BG 36 #1




BG 37 #1




BG 38 #1

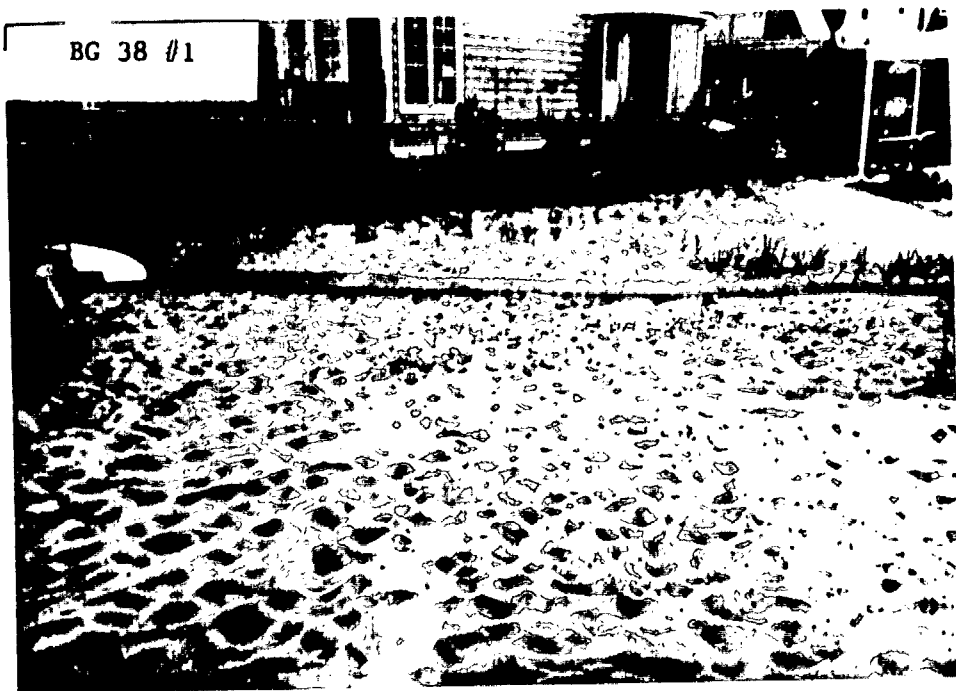

BG 38 #2

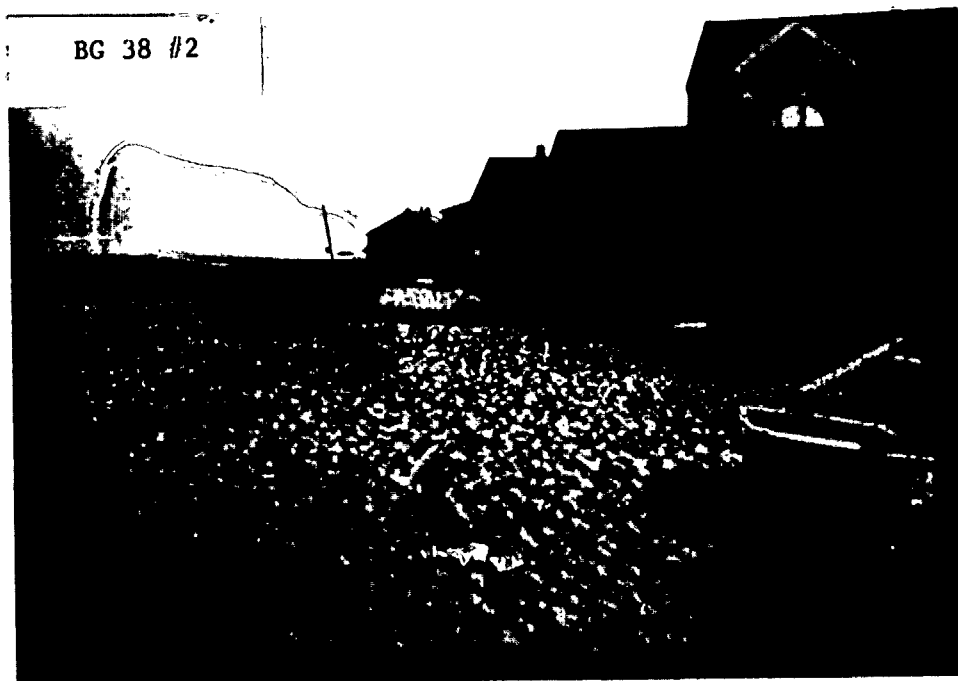

BG 39 #1

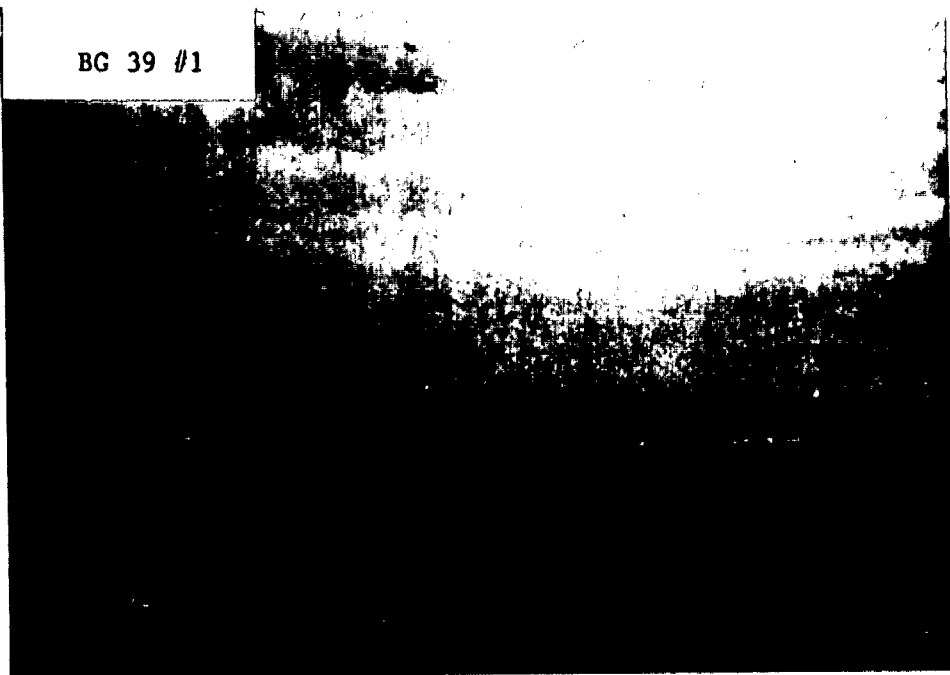


BG 40 #1



BG 40 #2



BG 41 #1

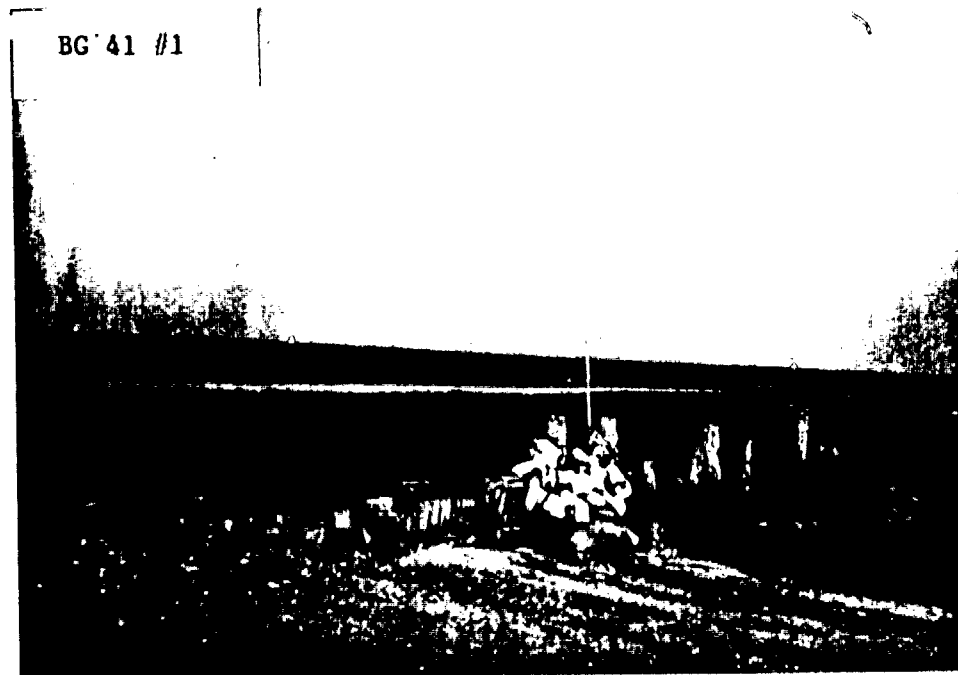


BG 42 #1



BG 43 #1



BG 44 #1

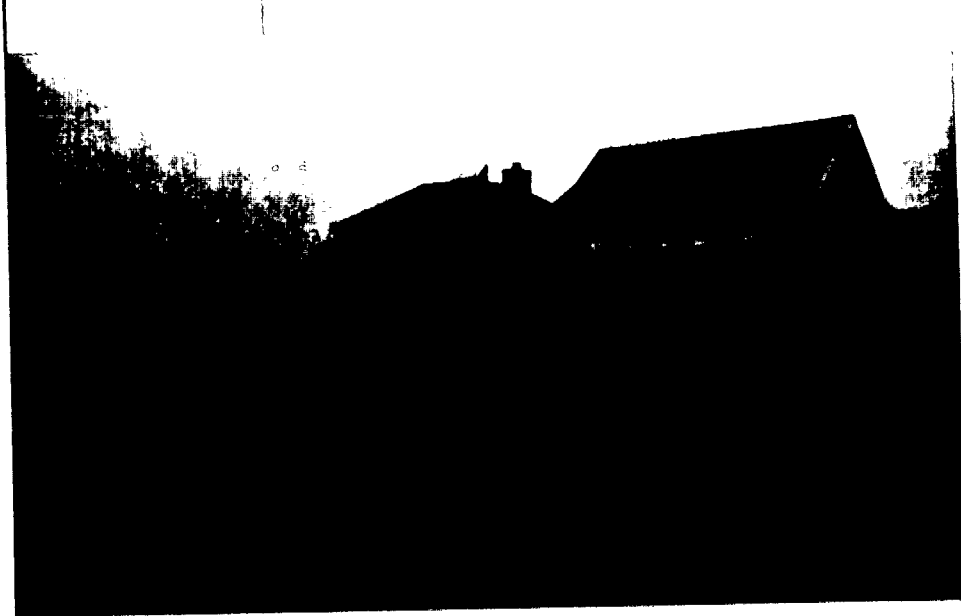


BG 44 #2



BG 45 #1




BG 46 #1

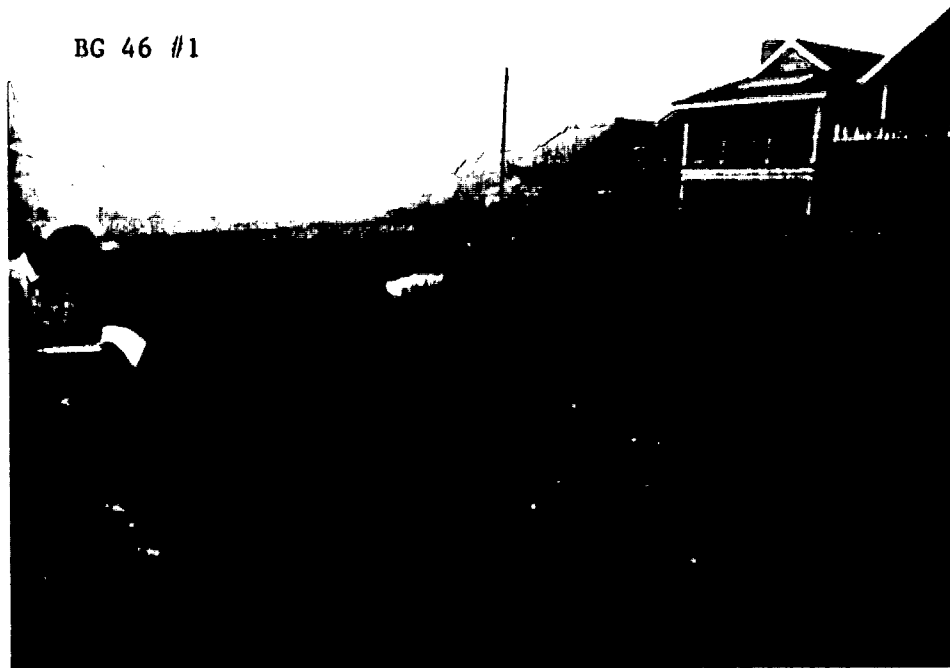

BG 46 #2



BG 47 #1

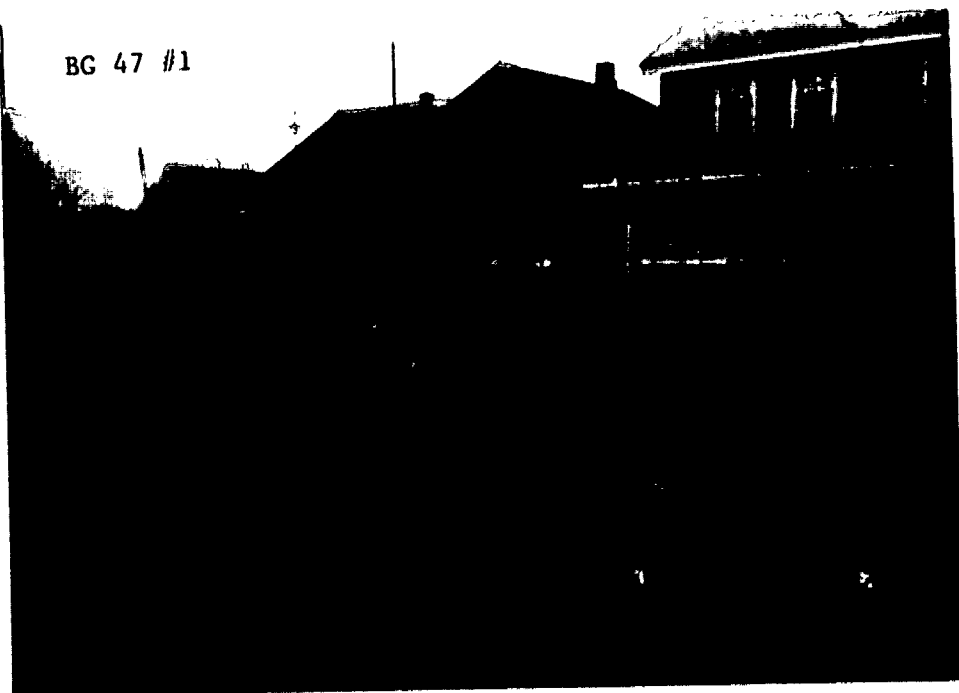


BG 47 #2



BG 47 #3



BG 48 #1

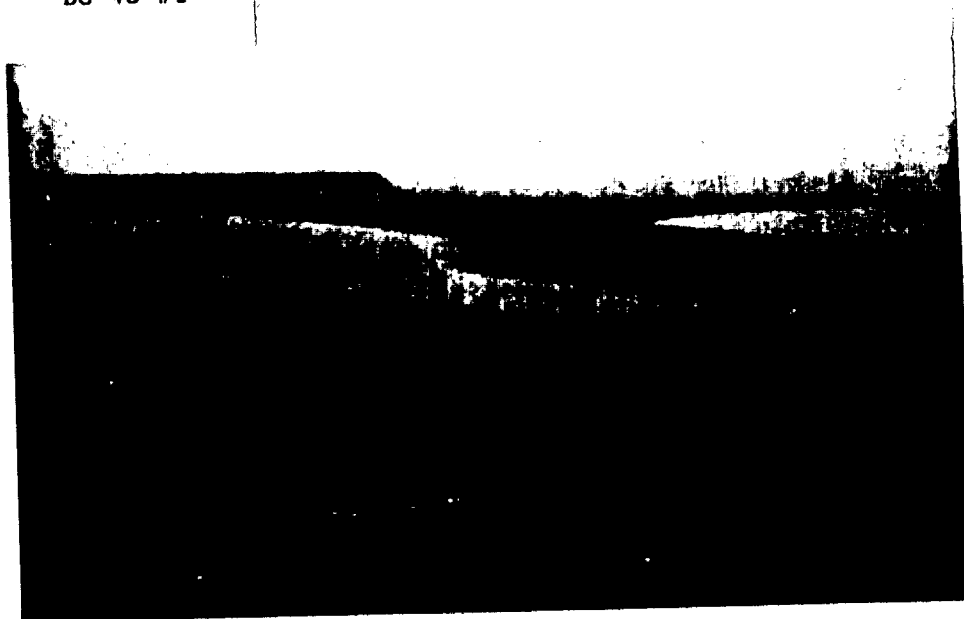

BG 49 #1




BG 50 #1




BG 52 #2



BG 51 #1

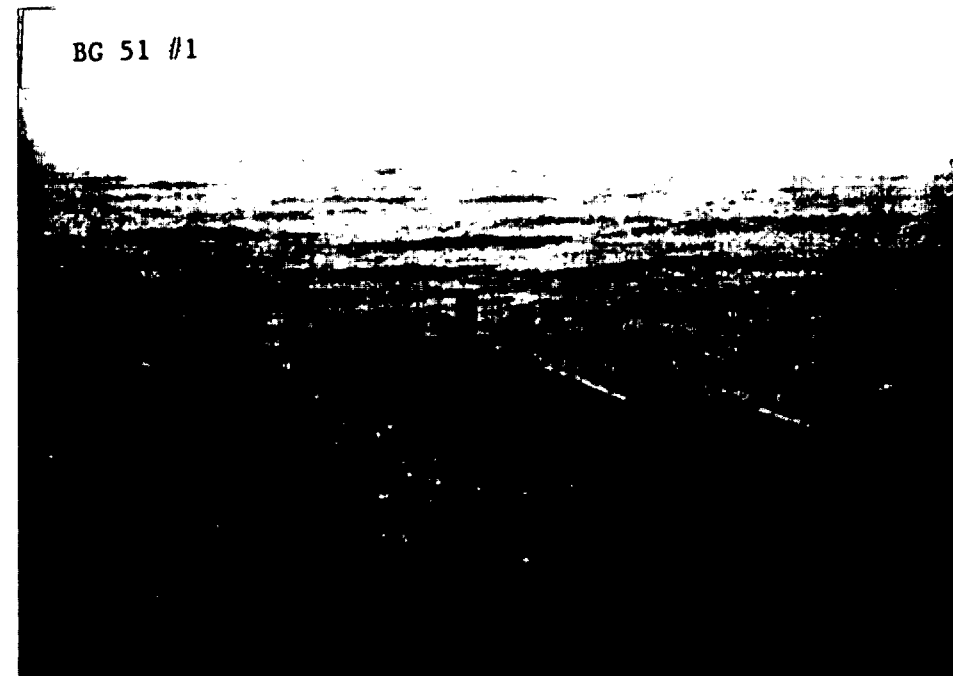

BG 52 #1

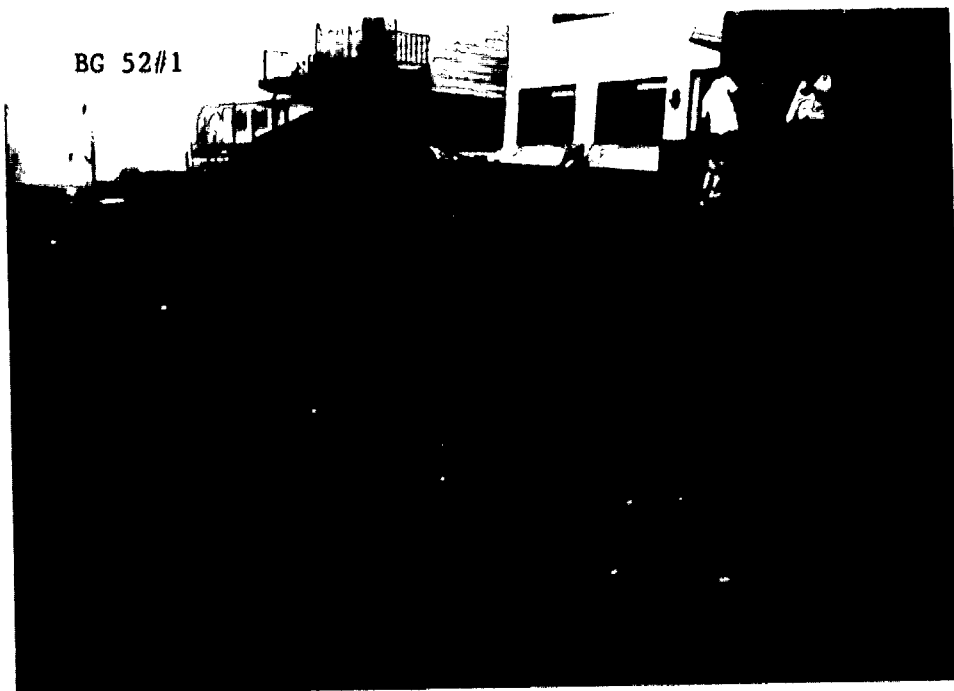


BG 53 #1



BG 54 #1



BG 55 #1

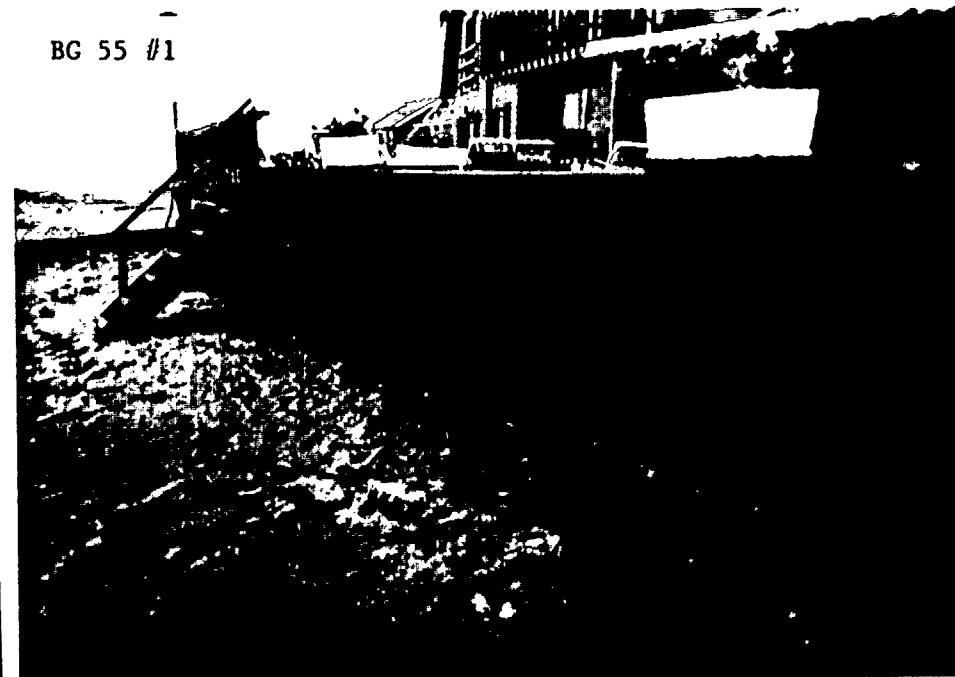

BG 56 #1




BG 56 #2



BG 57 #1



BG 58 #1

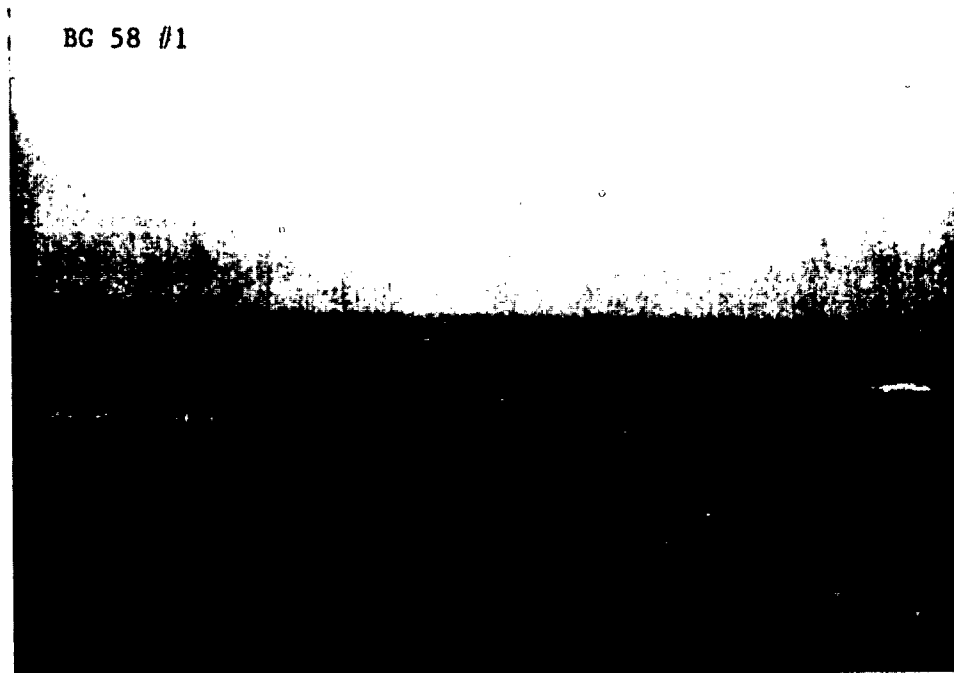

BG 59 #1




BG 59 #2



BG 60 #1



BG 61 #1

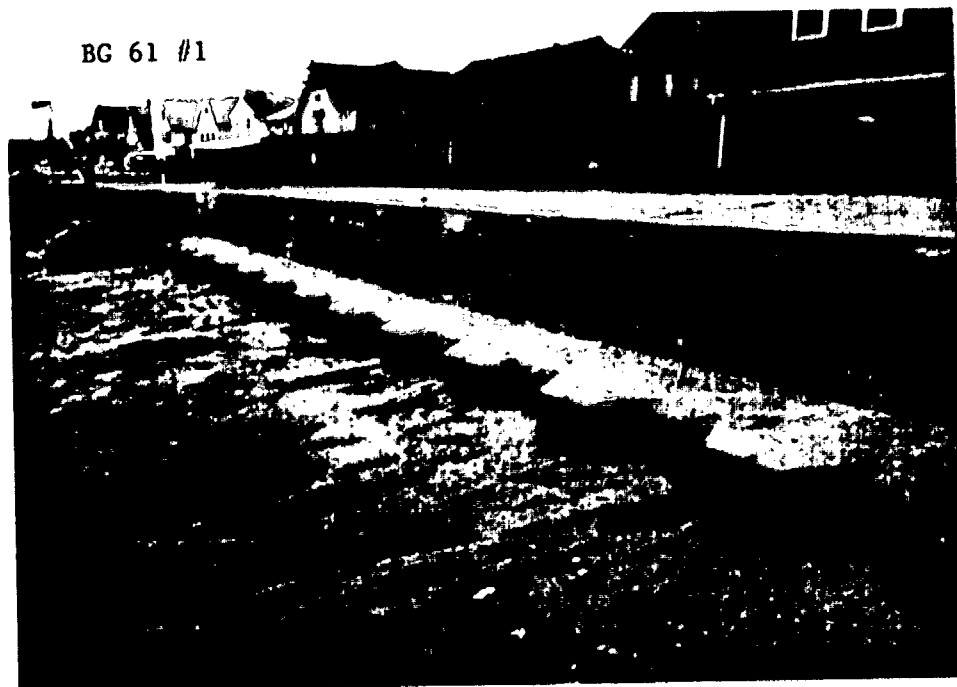


BG 62 #1




BG 62 #2



BG 63 #1

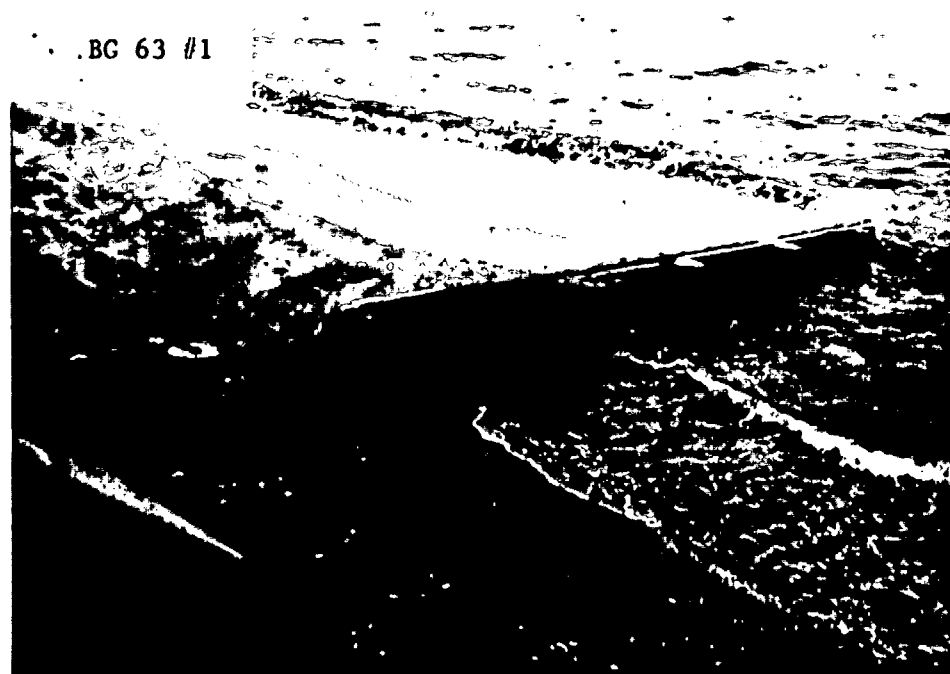

BG 64 #1

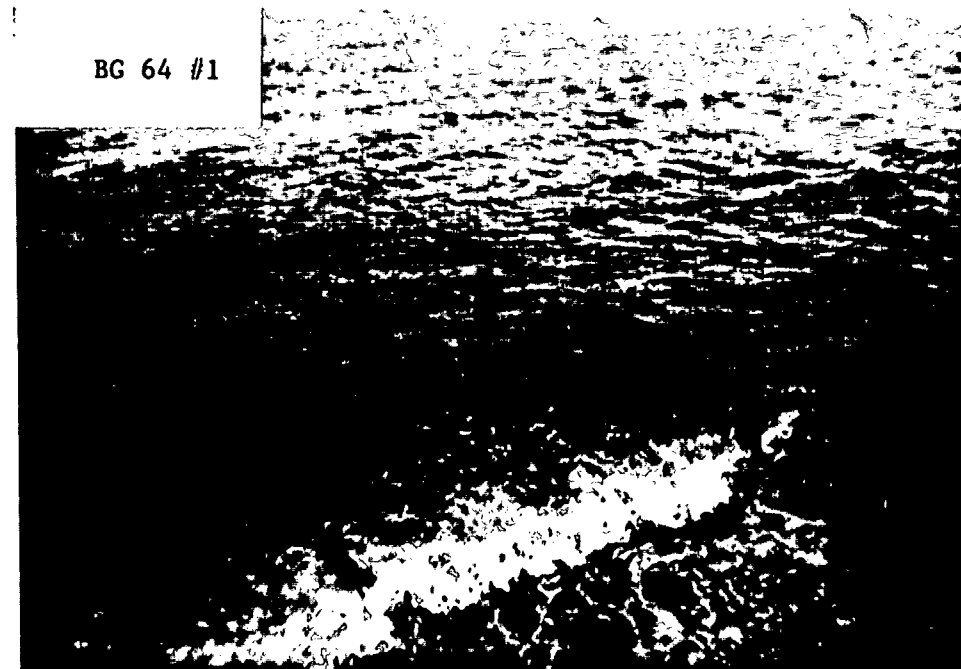

BG 65 #1



BG 66 #1

